

BLEEDING PROCEDURE FOR CM090, CM091, CM092 & CM093

1. Fill reservoir with fluid and start engine. Continue to add fluid until level remains full, and keep full throughout procedure.
2. Crack bleeder bolt on power steering gearbox until fluid appears, then tighten. Turn steering wheel lock to lock several times, then crack bleeder bolt again, tightening when fluid appears.
3. If fluid is aerated at this point (cloudy and/or foamy) car will need to be left running until fluid is smooth and clear.
4. Repeat step #2 **twice**.
5. Take car for test drive. If steering performs properly, bleeding is complete. If there is any lack of or variation in power assist, repeat step #4.
6. If there are any problems or questions, please contact the tech line at 702-734-8090.